


**LEGEND**

● UTILITY/POWER POLE	● SIGNAL PULLBOX	DC DETECTOR CHECK
○ SEWER MANHOLE	■ CABLE TV PULLBOX	BFY BACK FLOW VALVE
○ STORM DRAIN MANHOLE	■ COMMUNICATIONS PULLBOX	BW BACK OF WALK
○ TELEPHONE MANHOLE	■ UNKNOWN PULLBOX	TM TOP OF WALL
● FIRE HYDRANT	○ FINE DIRT CONNECTION	AC ASPHALT PAVEMENT
○ GREASE TRAP MANHOLE	○ CHAIN LINK FENCE	○ EXISTING ELEVATION
○ ROSE BIB	○ IRON FENCE	○ CENTERLINE
○ SEWER CLEANOUT	○ TREE	○ TELEPHONE PULLBOX
○ WATER VALVE	○ PINE	○ ELECTRIC PULLBOX
○ GAS VALVE	○ BUSH	○ IRRIGATION VALVE
○ WATER METER	○ TRASH ENCLOSURE	○ GUARD POST
○ GAS METER	○ TR ELECTRICAL TRANSFORMER	○ PROPERTY LINE
○ WATER VAULT	○ FS FINISHED SURFACE	○ FLOW LINE
○ TELEPHONE VAULT	○ FF FINISHED FLOOR	○ LOT LINE
○ ELECTRIC VAULT	○ GB GRADE BREAK	○ GRATE
○ SIGNAL VAULT	○ TC TOP OF CURB	○ FLAG POLE
○ COMMUNICATIONS VAULT	○ FL FLOW LINE	○ FIRE SPRINKLER RISER
○ STREET LIGHT	○ TG TOP OF GRATE	○ SURVEY MONUMENT
○ TRAFFIC SIGNAL	○ TCB IRRIGATION CONTROL BOX	○ SIGN POST
○ CITY WIRE	○ TCB TRAFFIC CONTROL BOX	○ INVERT
○ GROUND ROD WELL	○ EP EDGE OF PAVEMENT	○ CONCRETE
○ WATER BLOWOFF VALVE	○ BLOCK WALL	
○ MONITORING WELL		

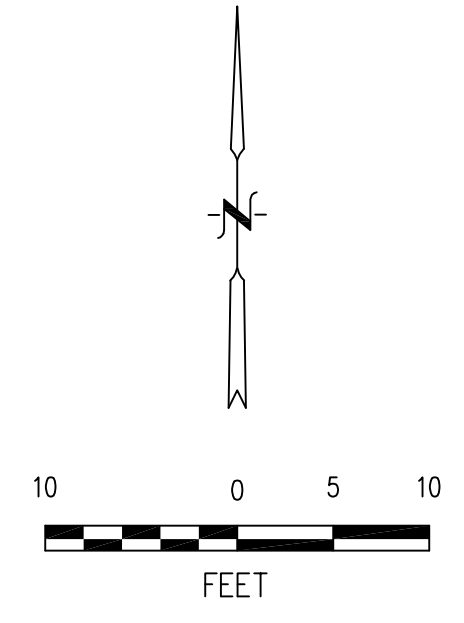

**UTILITY NOTE**  
 UTILITY LINES SHOWN HEREON REPRESENT PAINT MARKS MADE BY GROUND PENETRATING RADAR SYSTEMS (GPRS), THE CONSULTANT HIRED FOR THIS TASK.  
 [1'-2'] REPRESENT DEPTH PAINTED ON THE SURFACE BY GPRS  
 [E05] REPRESENT TEXT PAINTED ON THE SURFACE BY GPRS  
 [EQ5] REPRESENT QUESTION MARKS PAINTED ON THE SURFACE BY GPRS  
 INDICATING LOSS OF SIGNAL WHILE DETECTING THE LINE

---W--- REPRESENT WATER LINES  
 ---P--- REPRESENT POWER LINES  
 ---S--- REPRESENT POWER FOR STREET LIGHTS  
 ---G--- REPRESENT GAS LINES  
 ---C--- REPRESENT COMMUNICATIONS LINES  
 ---UNK--- REPRESENT UNKNOWN UTILITY LINES  
 ---SD--- REPRESENT STORM DRAIN LINES

THE SURVEYOR DOES NOT GUARANTEE THE ACCURACY OF THE PAINT MARKS LEFT BY GPRS AND ASSUMES NO LIABILITY FOR THEIR OCCUPANCY OR THE LOCATION OF UNDERGROUND UTILITIES.

**SURVEYOR'S NOTES**  
 R1 INDICATES RECORD PER PARCEL MAP NO. 36518, PMB 236/76-78

**REVISIONS**

NO.	DESCRIPTION	DATE	BY
0	FIRST SUBMITTAL	1/3/22	XS

**BASIS OF BEARINGS**  
 NORTH 7° 27' 50" EAST ALONG THE CENTERLINE OF BUENA VISTA AVENUE AS SHOWN ON PARCEL MAP NO. 36518, MB 236/76-78.

**BENCHMARK**  
 CITY OF CORONA BENCHMARK C-117 ELEVATION 685.379  
 A 2-1/2" BRASS DISK STAMPED "C-117" SET IN THE TOP OF CURB, LOCATED 5' NORTH OF THE E.C.R. OF THE NORTHEASTERN CURB RETURN OF THE INTERSECTION OF LINCOLN AVENUE AND SIXTH STREET.

**PREPARED FOR**  
 CORONA - NORCO  
 UNIFIED SCHOOL DISTRICT

**PREPARED BY**  
**SALAZAR SURVEYING, INC**  
 1655 E 6TH STREET, SUITE 44A  
 CORONA, CA 92879  
 PH (951) 898-8338 FAX (951) 898-4732

**TOPOGRAPHIC SURVEY**  
**CNUSD TRANSPORTATION YARD**  
**300 SOUTH BUENA VISTA AVENUE**  
**CORONA, CA 92882**

DRAWN BY: XS CHECKED BY: SJS SCALE: 1" = 10' DATE: 1/3/22 JOB NO.: SS22057 SHEET 1 OF 1